

INSTALLATION INSTRUCTIONS FDOA Series –Downlead Clamp (Banding Option)

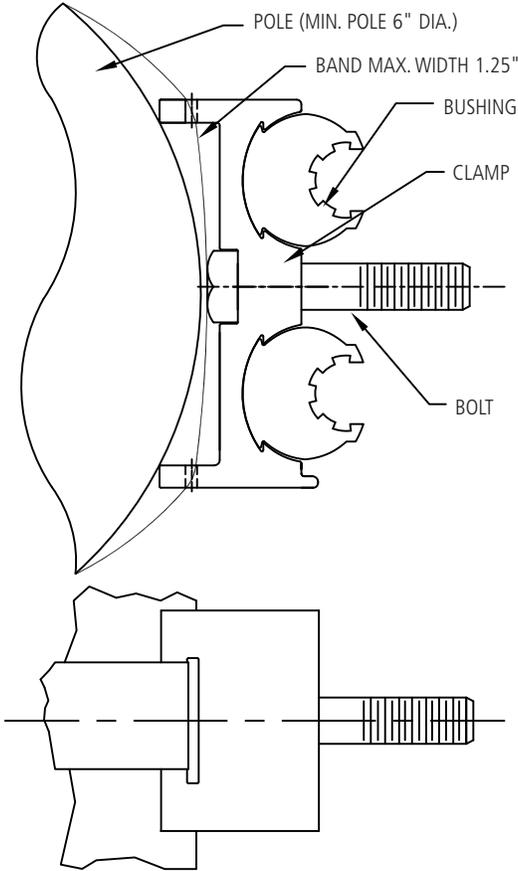


FIG. 1

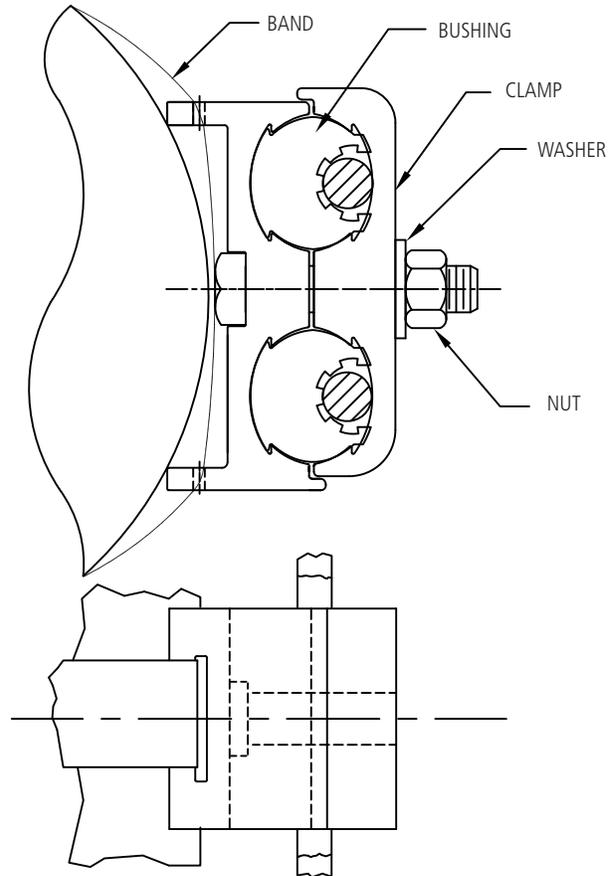


FIG. 2

1. Assemble bolt with bottom clamp as illustrated in **Fig. 1**.
2. Band (max. width 1.25") the bottom clamp (band to be supplied by customer) securely to the pole at the appropriate location as illustrated in **Fig. 1**.
3. Lay the proper OPGW and/or ADSS cable in each bushing groove of the bottom clamp. Place top clamp over the cables and ensure the bushing color code and cable diameter match the table below.
4. Tighten the bolt on the downlead clamp until a bolt torque of 20-25lb-ft is achieved. See **Fig. 2**.

COLOR	RED-B4	GREEN-B5	YELLOW-B6	BLUE-B7	WHITE-B8	BLACK-B9	B10
RANGE	.400 - .500	.501 - .600	.601 - .700	.701 - .800	.801 - .900	.900 - 1.00	1.001 - 1.100

CAUTION: In order to avoid any damage to the OPGW and/or ADSS cable, it is essential that the cable be clamped only in the recommended bushings.