

Installation Instructions

Speed-Grip[®] Spacers

2.

 Prior to installation, slide open the spacer assembly giving a clamp opening of approximately 1½ times the conductor diameter. Finger-tighten the wedge-lock pin enough to hold the spacer assembly in the open position.

Position spacer assembly between the two conductors, so that it is perpendicular to the conductors.

Wedge Lock Pin

- 3. Rotate the spacer assembly until the conductors rest in the open clamps.
- 4. Loosen the wedge-lock pin and slide the spacer assembly closed. Finger-tighten the wedge-lock pin to engage the pin with lower spacer half lock hole.
- 5. Using a 12" (30 cm) ratchet wrench with a 6-point deep socket, tighten the wedge-lock pin until breakaway head shears off.
- 6. Make final visual inspection to ensure that the spacer is properly seated on the conductor, shear head is missing and the wedge-lock pin head is free of burrs.





Half Lock Hole



INSTALLATION